



X125 350 bar submersible stand-alone linear position sensor INTRINSICALLY SAFE FOR HAZARDOUS GAS/VAPOUR ATMOSPHERES

- Intrinsically safe for Gas to: Ex II 1G
- Travel set to customer's requirement
- **Compact and self-contained**
- High durability and reliability
- High accuracy and stability
- Sealing to IP68 350 Bar

As a leading designer and manufacturer of linear, rotary, tilt and intrinsically safe position sensors, Positek $^{\circledast}$ has the expertise to supply a sensor to suit a wide variety of applications.

Our X125 incorporates electronics system EX07 which is ATEX / IECEx / UKEX approved for use in potentially explosive gas/vapour atmospheres. The X125 is designed to provide feedback for arduous underwater applications, such as ROVs, where hazardous surface conditions may exist. remains an affordable, durable, high-accuracy The unit is highly compact and spaceposition. efficient, being responsive along almost its entire Like all Positek[®] sensors, the X125 length. linear output proportional provides а to Each sensor is supplied with the displacement. output calibrated to the travel required by the customer, from 5 to 800mm and with full EMC protection built in.

The sensor is very robust, the body and push rod being made of stainless steel for long service life and environmental resistance. Overall performance, repeatability and stability are outstanding over a wide temperature range. The sensor is easy to install with mounting options including M8 rod eye bearings and body clamps. The push rod can be supplied free or captive with male M8 thread, an M8 rod eye, dome end or magnetic tip. M12 and 1/2" rod eye option available. Captive push rods can be sprung loaded, in either direction, on sensors up to 300 mm of travel. The X125 also offers a range of mechanical options, environmental sealing is to IP68 350 Bar.



SPECIFICATION								
Dimensions								
Body diameter	40 mm electronics and 35 mm							
Body length (Axial version)	measurement length + 184 mm							
Body length (Radial version)	measurement length + 189 mm							
Push rod extension	measurement length + 7 mm, OD 12.6 mm							
For full mechanical details see dra	awing X125-11							
Power Supply	$+5V$ dc nom. \pm 0.5V, 10mA typ 20mA max							
Output Signal	0.5-4.5V dc ratiometric, Load: $5k\Omega$ min.							
Independent Linearity	≤ ± 0.25% FSO @ 20°C - up to 450 mm							
	≤ ± 0.5% FSO @ 20°C - over 450 mm							
	$\leq \pm 0.1\%$ FSO @ 20°C ⁻ available upon request.							
*Sensors with calibrated displaceme	nt of between 10 and 400 mm.							
Temperature Coefficients	< ± 0.01%/°C Gain &							
•	< ± 0.01%FS/°C Offset							
Frequency Response	> 10 kHz (-3dB)							
Resolution	Infinite							
Noise	< 0.02% FSO							
Intrinsic Safety	Ex II 1G							
	Ex ia IIC T4 Ga (Ta= -40°C to 80°C)							
Approval only applies to the specifie conditions in the range 0.80 to 1.10	d ambient temperature range and atmospheric Bar, oxygen $\leq 21\%$							
Sensor Input Parameters	Ui: 11.4V, Ii: 0.20A, Pi: 0.51W.							
(without cable)	Ci: 1.16µF, Li: 50µH							
(with cable)	Ci: 1.36µF, Li: 860µH with 1km max. cable							
Environmental Temperature Limits (Non Icing)								
Operating	-4 to +50°C							
Storage	-4 to +50°C							
Sealing	IP68 350 Bar							
EMC Performance	EN 61000-6-2, EN 61000-6-3							
Vibration	IEC 68-2-6: 10 g							
Shock	IEC 68-2-29: 40 g							
MTBF	350,000 hrs 40°C Gf							
Drawing List	Carran Outline							
X125-11 Drawings in AutoCAD [®] dwg or dyf	Sensor Outline							

Drawings, in AutoCAD[®] dwg or dxf format, available on request.

Do you need a position sensor made to order to suit a particular installation requirement or specification? We'll be happy to modify any of our designs to suit your needs please contact us with your requirements.





X125 350 BAR SUBMERSIBLE STAND-ALONE LINEAR POSITION SENSOR INTRINSICALLY SAFE FOR HAZARDOUS GAS/VAPOUR ATMOSPHERES

Intrinsically safe equipment is defined as "equipment which is incapable of releasing sufficient electrical or thermal energy under normal or abnormal conditions to cause ignition of a specific hazardous atmosphere mixture in its most easily ignited concentration.

ATEX / IECEx / UKEX approved to;

Ex II 1G

Ex ia IIC T4 Ga (Ta= -40°C to 80°C)

Designates the sensor as belonging to; Group II: suitable for all areas **except mining**, Category 1 G: can be used in areas with continuous, long or frequent periods of exposure to hazardous gas / vapour (Zones 2 to 0).

Gas / Vapour:

Protection class ia, denotes intrinsically safe for all zones Apparatus group IIC: suitable for IIA, IIB and IIC explosive gas / vapour.

Temperature class T4: maximum sensor surface temperature under fault conditions 135°C.

Ambient temperature range extended to -40°C to +80°C. It is imperative Positek[®] intrinsically safe sensors be used in conjunction with a galvanic barrier to meet the requirements of the product certification. The Positek X005 Galvanic Isolation Amplifier is purpose made for Positek IS sensors making it the perfect choice. Refer to the X005 datasheet for product specification and output configuration options.

Safety Parameters:-

Ui: 11.4V, Ii: 0.20A, Pi: 0.51W Ci = 1.36μ F* Li = 860μ H* (cable option/s) Ci = 1.16μ F Li = 50μ H (connector option/s)

*Figures for 1km cable where: Ci = 200pF/m & Li = 810nH/m

Sensors can be installed with a maximum of 1000m of cable. Cable characteristics must not exceed:-

Capacitance: $\leq 200 \text{ pF/m}$ for max. total of: Inductance: $\leq 810 \text{ nH/m}$ for max. total of: 200 nF. 810 µH. For cable lengths exceeding 10 metres a five wire connection is recommended to eliminate errors introduced by cable resistance and associated temperature coefficients.

ATEX / IECEx / UKEX approved sensors suitable for dust (E series) and mining (M series) applications, are also available from Positek.

TABLE OF OPTIONS

MEASUREMENT RANGE:

800 mm in increments of 1mm. **ELECTRICAL INTERFACE OPTIONS**

The Positek® X005 Galvanic Isolation Amplifier is available with the

following output options; Standard: 0.5 - 9.5V or 4 - 20mA. Reverse: 9.5 - 0.5V or 20 - 4mA.

CONNECTOR

Wet mate 4 pin MC BH-4-M (axial or radial) Supplied with a connector and 0.5 m, 4x0.5mm² cable assembly as standard. Mating connector with longer lengths available.

Factory-set to any length from 5 to


We recommend all customers refer to the 3 or 5-Wire Mode Connection page.

MOUNTING OPTIONS

M8 rod eye bearing (radial versions), Body Tube Clamp/s (axial or radial versions). M12 and 1/2" rod eye option available.

PUSH ROD OPTIONS – Retained[†] or Free with M8x1.25 male thread, M8 rod eye bearing or Magnetic tip, Spring loaded - retract or extend, Dome end[#].

standard, retained with female thread. [#] with spring extend.

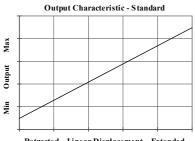

Retracted Linear Displacement Extended





Three or Five-Wire Mode Connection FOR INTRINSICALLY SAFE SENSORS IN HAZARDOUS ATMOSPHERES

The aim of this document is to help readers who do not understand what is meant by three or five wire modes of connection between the galvanic isolation amplifier and sensor, and the factors behind them. It is by no means an in-depth technical analysis of the subject.

Whether opting for a pre-wired Positek[®] Intrinsically Safe sensor or one with a connector, choosing the right mode of connection and cable to suit the application requires careful consideration.

Interconnecting cables are not perfect conductors and offer resistance to current flow, the magnitude of resistance[†] depends on conductors resistivity, which changes with temperature, cross sectional area[‡] and length. If the voltage were to be measured at both ends of a length of wire it would be found they are different, this is known as volts drop. Volts drop changes with current flow and can be calculated using Ohm's law, it should be noted that volts drop occurs in both positive and negative conductors. The effects of volts drop can be reduced by increasing the conductors cross sectional area, this does not however eliminate the effects due to temperature variation. There are instances where large cross-section cables are not practical; for example most standard industrial connectors of the type used for sensors have a maximum conductor capacity of 0.75mm², copper prices and ease of installation are other considerations.


This is important because the effects of volts drop can significantly alter the perceived accuracy of the sensor which is ratiometric i.e. the output signal is directly affected by the voltage across the sensor. Changes in temperature will also be seen as gain variation in the sensor output.

Three wire mode connections are common and are suitable in most cases with short or moderate cable runs. Applications that do not require a high degree of accuracy but have cable runs, say in excess of 10m, volts drop can reduced by introducing a terminal box close to the sensor and using a larger cross-section cable for a majority of the cable run. Sensors supplied with three core cable are calibrated with the cable fitted which largely eliminates errors due to conductor resistance at room temperature however, as mentioned above, small gain errors due to temperature fluctuations should be expected.

Five wire mode connections have significant benefits as losses in the positive and negative conductors are compensated for by the galvanic isolation amplifier which can 'sense' the voltage across the sensor and dynamically adjust the output voltage so that the voltage across the sensor is correct. The effects of cable resistance and associated temperature coefficients are eliminated allowing for smaller conductors than a three wire connection for the same cable run. The amplifier can compensate for up to 15Ω per conductor with a current flow of 15mA, which is more than adequate for 150m of 0.25 mm² cable, longer lengths will require larger conductors.

For this reason Positek[®] recommends five wire connections for cable lengths exceeding 10 metres in 0.25 mm² cable to preserve the full accuracy of the sensor.

See illustrations below for examples of connecting a sensor to the galvanic isolation amplifier.

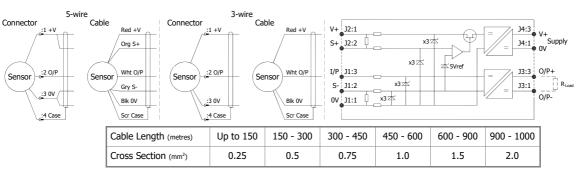

The table above shows recommended conductor sizes with respect to cable length for both three and five wire connections, based on copper conductors. Three wire connections will introduce a gain reduction of 5% and a $\pm 1\%$ temperature dependence of gain over the range -40°C to +80°C for the cable temperature. (i.e. about -150 ppm/°C for the maximum lengths shown and less pro rata for shorter lengths.)

It should be noted that the maximum cable length, as specified in the sensor certification, takes **precedence** and **must not** be exceeded.

Positek[®] sensors are supplied with three core 0.25 mm² cable as standard, however five core 0.25 mm² cable can be supplied on request. The galvanic isolation amplifier is available as;

G005-*** for `G' and `H' prefix sensors X005-*** for `E', `M' and `X' prefix sensors

 $\frac{1}{2}$ R = ρ L/A ρ is the resistivity of the conductor (Ω m) L is the length of conductor (m) A is the conductor cross-sectional area (m²).

^{*}It is presumed that **d**irect **c**urrent flow is uniform across the cross-section of the wire, the galvanic isolation amplifier and sensor are a dc system.




Intrinsically Safe - Gas/Vapour Atmospheres X125 350 Bar Submersible Stand-Alone Linear Position Sensor

	а	b	с	d	е	f	g	h	
	X125 . Displacement	A	Connections	Option	Option	Option	Option	Option	Z
a Displacement (mm)		Va	lue						
Displacement in mm	e.g. 0 - 254 mm	2	54						
b Output									
Supply V dc V _s (tolerance)	Output	Co	de						
+5V (4.5 - 5.5V)	0.5 - 4.5V (ratiometric with supply)	1	A						
c Connections		Co	de						
Connector - Axial	IP68 350 Bar Wet mate 4 pin MC	ינ	50						
Connector - Radial	BH-4-M plus pre-wired mating connector	K	50						
d Body Fittings		Co	de						
None - default		bla	ank						
M8 Rod-eye Bearing	Radial body style only	I	N						
e Body Clamps		Co	de						
Body Clamps - 1 pair		I	P						
Body Clamps - 2 pairs		P	2						
f Sprung Push Rod		Co	ode						
None - default		bla	ank						
Spring Extend	Up to 300mm displacement.	I	R						
Spring Retract	Captive push rod only.	9	S						
g Push Rod Fittings		Co	de						
None - default	Female Thread M8x1.25x12 deep	bla	ank						
Dome end	Requires option 'R'	•	г						
M8 Rod-eye Bearing		I	U						
Magnetic Tip		W	/A						
h Push Rod Options		Co	de						
Captive - default	Push rod is retained	bla	ank						
Non-captive	Push rod can depart body	,	v						
j Z-code		Co	de						
Calibration to suit X005 -	Default	ZO	00						
≤± 0.1% @20°C Indeper 10mm & 400mm only!	ndent Linearity displacement between	Z 6	50						
1/2" Rod eye options ava	ilable	Z 8	25						
M12 Rod eye options ava	ilable	Z8	26						

All Intrinsically Safe (IS) sensors must have a Z-code suffix. IS sensors must be used in conjunction with a Galvanic Isolation Amplifier - See X005 for Output options.

Positek Installation Information X125 350BAR SUBMERSIBLE STAND-ALONE LINEAR POSITION SENSOR INTRINSICALLY SAFE FOR HAZARDOUS GAS/VAPOUR ATMOSPHERES

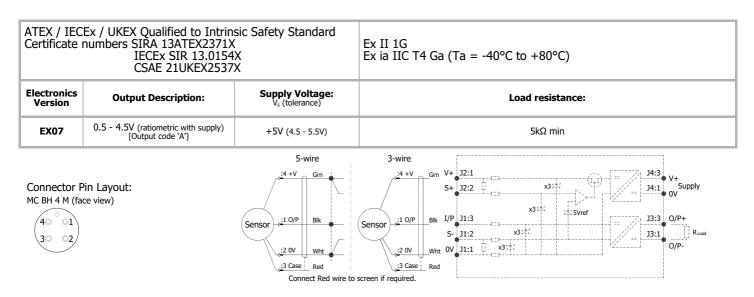

Putting Into Service: The sensor must be used with a galvanic isolation barrier designed to supply the sensor with a nominal 5V and to transmit the sensor output to a safe area. The barrier parameters must not exceed:-

Ui = 11.4V	Ii = 0.20A	Pi = 0.51W
Ci = 1.36µF* Ci = 1.16µF	Li = 860µH* Li = 50µH	(with cable) *Figures for 1km cable (without cable)
	Ei = 50pii	(Without Cubic)

The sensor is certified to be used with up to 1000m of cable, cable characteristics must not exceed:-

Capacitance: \leq 200 pF/m or max. total of: 200 nF

Inductance: ≤ 810 nH/m or max. total of: 810 μ H

Approval only applies to specified ambient temperature range and atmospheric conditions in the range: 0.80 to 1.10 Bar, oxygen \leq 21%.

The performance of the sensor may be affected by voltage drops associated with long cable lengths; for cable runs exceeding 10 metres a five wire connection is recommended to eliminate errors introduced by cable resistance and associated temperature coefficients.

N.b. Cable free end must be appropriately terminated, including preventing water ingress into the cable. See page 2 for connector handling instructions.

Special Condition for Safe Use:

The apparatus does not meet the 500 V r.m.s dielectric strength test between circuit and frame, in accordance with clause 6.3.13 of IEC 60079-11:2011. This must be taken into consideration on installation.

When using a Sensor that has an integral cable in a dust application, the free end of the cable shall be appropriately terminated for the zone of use.

Under certain extreme circumstances, the non-metallic and isolated metal parts incorporated in the enclosure of this equipment may generate an ignition-capable level of electrostatic charge. Therefore the equipment shall not be installed in a location where the external conditions are conducive to the build-up of electrostatic charge on such surfaces. This is particularly important if the equipment is installed in a zone 0 location. In addition, the equipment shall only be cleaned with a damp cloth.


Use: The sensor is designed to measure Rotary displacement and provide an analogue output signal.

Assembly and Dismantling: The unit is not to be serviced or dismantled and re-assembled by the user.

Maintenance: No maintenance is required.

Mechanical Mounting: Mounting: Depending on options; Body can be mounted by rod eye bearing or by clamping the sensor body - body clamps are available, if not already ordered. Target by M8x1.25 male thread, rod eye bearing or magnetic tip. It is assumed that the sensor and target mounting points share a common earth.

Output Characteristic: Target is extended 7 mm from end of body at start of normal travel. The output increases as the target extends from the sensor body, the calibrated stroke is between 5 mm and 800 mm.

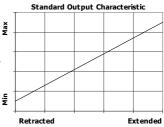

Linear Displacement

Incorrect Connection Protection levels:- The sensor is not protected against either reverse polarity or over-voltage. The risk of damage should be minimal where the supply current is limited to less than 50mA.




Positek Installation Information X125 350BAR SUBMERSIBLE STAND-ALONE LINEAR POSITION SENSOR INTRINSICALLY SAFE FOR HAZARDOUS GAS/VAPOUR ATMOSPHERES

Handling

- Always apply grease before mating
- Disconnect by pulling straight, not at an angle
- Do not pull on the cable and avoid sharp bends at cable entry
- When using a bulkhead connector, ensure that there are no angular loads
- Do not over-tighten the bulkhead nuts
- SubConn[®] connectors should not be exposed to extended periods of heat or direct sunlight. If a connector becomes very dry, it should be soaked in fresh water before use


Greasing and mating above water (dry mate)




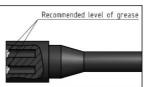

- Connectors must be greased with Molykote 44 Medium before every mating
- A layer of grease corresponding to minimum 1/10 of socket depth should be applied to the female connector
- The inner edge of all sockets should be completely covered, and a thin transparent layer of grease left visible on the face of the connector
- After greasing, fully mate the male and female connector in order to secure optimal distribution of grease on pins and in sockets
- To confirm that grease has been sufficiently applied, de-mate and check for grease on every male pin. Then re-mate the connector

Greasing and mating under water (wet mate)

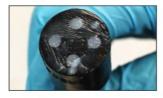

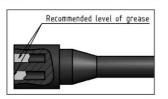

- Connectors must be greased with Molykote 44 Medium before every mating
- A layer of grease corresponding to approximately 1/3 of socket depth should be applied to the female connector
- All sockets should be completely sealed, and transparent layer of grease left visible on the face of the connector
- After greasing, fully mate the male and female connector and remove any excess grease from the connector joint



Cleaning

- General cleaning and removal of any accumulated sand or mud on a connector should be performed using spray based contact cleaner (isopropyl alcohol)
- New grease must be applied again prior to mating